

Service Bulletin

SB 16-1
2-8-79



SUBJECT: OIL FILTER
VEHICLES: ALL MODELS

CONDITION: Wrong type of oil filter being used as replacement. The Fram 2804 oil filter does not contain a stand pipe. This allows the oil in the filter to drain back to the sump with the engine stopped and causes a delay in the lubrication of the cam shafts resulting in damage.

PARTS

INFORMATION: The recommended replacement oil filter contains the stand pipe to prevent the oil from draining with the engine stopped.

The Factory Recommended oil filters are:

- SAVARA PH-2804-1
- FRAM PH-2804-1
- LUCAS G085

WARRANTY

INFORMATION: The use of an unauthorized replacement oil filter could cause damage to the engine which is not covered by the warranty.