



## Service Bulletin

**SB 21-3**  
**6-25-81**

SUBJECT: CLUTCH PRESSURE PLATE  
VEHICLES: 308 GTSi and GTBi Models  
SERIAL NOS: Starting with the following serial number.

<u>Model</u>	<u>Serial No.</u>
GTSi	34143
GTBi	34191

SERVICE  
INFORMATION:

The configuration of the clutch pressure plate has been changed.


The diaphragm spring fingers of the new pressure plate are now curved and in direct contact with the release bearing.

Important: The new pressure plate must only be used on vehicles with "self-adjusting clutch release system."

PARTS  
INFORMATION:

<u>Description</u>	<u>Part No.</u>
Clutch Pressure Plate (with modified diaphragm spring fingers)	115451

NOTE: Clutch disc, Part No. 110296 may be used with both before and after modification pressure plates.

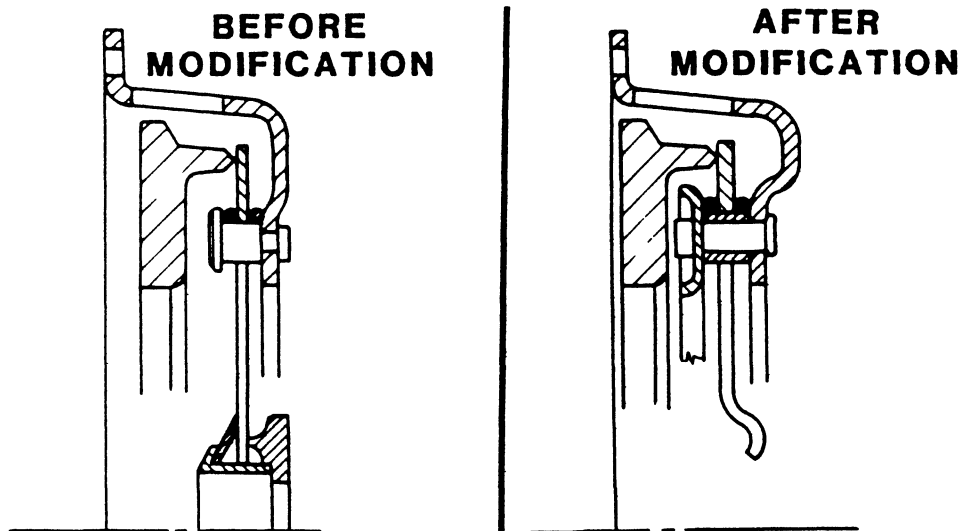

READ, INITIAL and PASS ON

SERVICE MANAGER	PARTS MANAGER	SERVICE WRITER	TECHNICAN