

Service Bulletin

SB 80-1
11-29-79



SUBJECT: WINDSHIELD WIPER
VEHICLES: DINO 246GT

SERIAL NO.:

Starting with No. 04248 (vehicles equipped with air pollution system)

REISSUE OF TECHNICAL BULLETIN NO. 207, DATED 11/30/72

SERVICE INFORMATION:

Due to the installation of a modified windshield wiper system, it is necessary to carefully check the load of the wiper arms to ensure proper wiper operation.

Make sure (see illustration)


- The wiper motor assembly is a Marelli TGE130D
- The driver side wiper arm
 - is 16" (406mm) in length
 - has a .3504" (8.9mm) blade
 - arm load of 800 gr. (1.75 lbs), measured without wiper blade
- The passenger side wiper arm
 - is 17" (431mm) in length
 - has a .3504" (8.9mm) blade
 - arm load of 650 gr. (1.4 lbs) measured without wiper blade
- Both wiper blades are 18" (457mm) in length

PARTS INFORMATION:

The part numbers of the components involved are

<u>Description</u>	<u>Part No.</u>
Wiper Motor	607E 401561
Driver side wiper arm	607E 401766
Passenger side wiper arm	607E 401765
Wiper blades	607E 401768

NOTE: This technical information updates the Body Spare Parts Books.

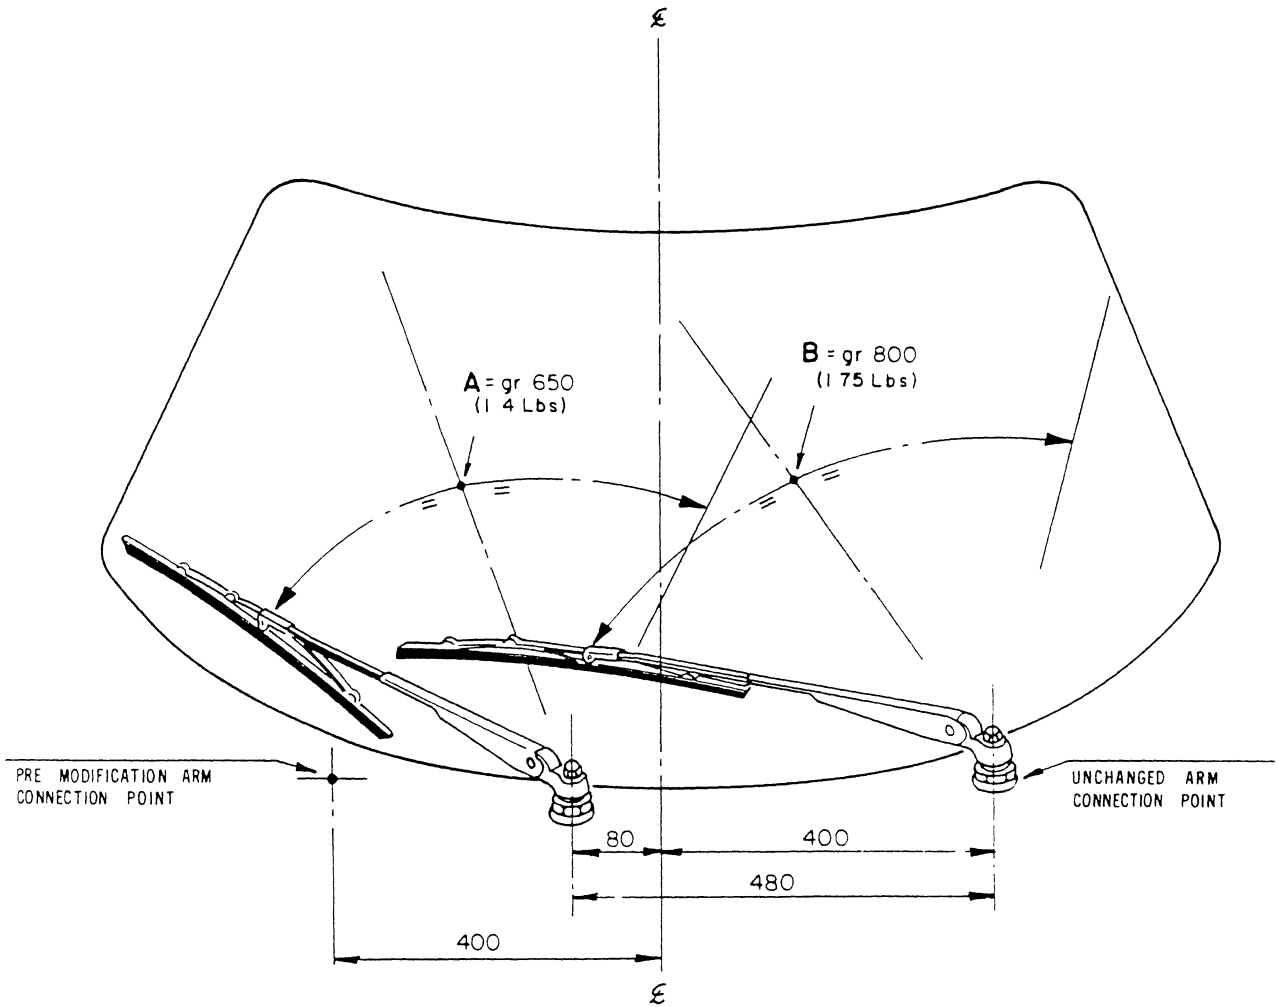

THE ARMS LOAD WITHOUT WIPER BLADES AND MEASURED ON THE "A" AND "B" POINTS, SHOULD BE OF GR 650 AND GR 800 RESPECTIVELY